

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 18

Township: 7 North


Range: 1 East

Corner ID: Polk A-13

Monument Description & Remarks: 3" diameter Aluminum cap, "2004 LS 20200079", 1ft above ground. Survey Sign 3ft above ground at pt. B

References On File: Matthew L. Cooper survey, Instrument Number 2005011737 (2004), on file in Recorder Office cabinet S, envelope 285

RECOVERY TIE DRAWING
Field Book 30 Page No. 22
Field Book 41 Page No. 08


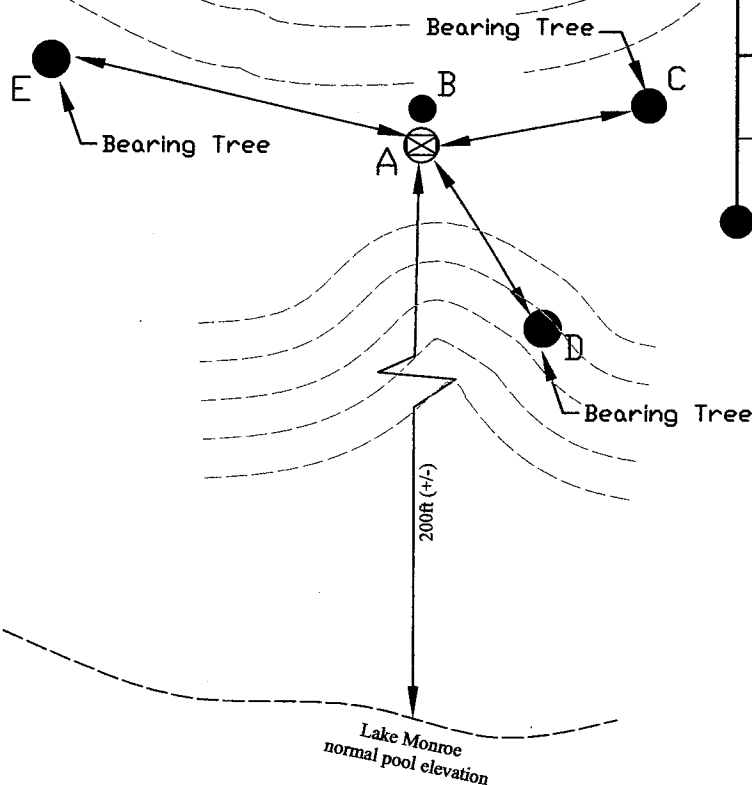


A - 3" Monument
B - N 04° E 1.39' to Survey
Sign on metal fence post
C - S 80° E 11.28' to MAG
nail in 11" White Oak
D - S 10° E 8.5' to MAG
nail in 15" White Oak
E - N 69° W 30.38' to MAG
nail in 11" Red Oak

Not To Scale
Compass Bearing Magnetic North

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 30th day of June, 2008.

Kevin P. Enright

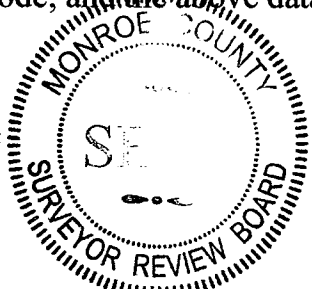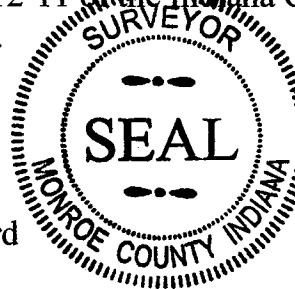

Administered by the Monroe County Surveyor Review Board

Date: 7-6-2008

Index: N-1	Corner: S.C.	LAND CORNER RECORD		State of Indiana Hoosier National Forest	
Twnshp: 7N	Range: 1E	Section: 19	2 nd P.M.	County	Monroe
Original Government Survey			Original Survey Evidence Found		
Year Surveyed: 1814	By: Arthur Henrie	Date of Search:		By:	
Original Monument:	Wood post		Monument Found:		
Species	Diameter	Bearing	Distance	Species	Diameter Bearing Distance
Hickory	6"	S 10°E	2 links		
Hickory	8"	S 85°E	13 links		
Subsequent Corner Restoration			Evidence of Subsequent Corner Restoration Found		
Where Filed or Recorded:	Monroe County Surveyors Office		Year Searched: 9/17/04	By: B.Stone	
Book: Page:	Date:		Monument Found	2 ½" diameter aluminum FS monument with a 3 ¼" cap standing 17" above the ground with a rock cairn and stamped as shown:	
Monument Set:			Species	Diameter	Bearing Distance

OTHER EVIDENCE

Describe corner loc. Relative to nearby features & dir. To corner location; note fences, roads, etc.	Sketch of Monument
The monument was set by Bledsoe, Tapp & Riggert INC. in September, 2004 The monument is located on a steep southwest slope at the head of a small steep drainage running to the south. A metal survey marker post stands 1.4 feet north. A large rock outcrop is north and uphill approximately 80 feet. The rock cairn around the monument is 2.5 feet in diameter and 14" high.	

PERPETUATION RECORD

Monument: Describe new monument set or work done to perpetuate/preserve the existing monument/position.



Corner Diagram		Accessories: Describe new BTs & witness objects established to perpetuate existing evidence.															
		These bearing trees are scribed, blazed, painted and have red paint bands: <table> <tr> <td>W. Oak</td> <td>W. Oak</td> <td>S. Oak</td> </tr> <tr> <td>10"</td> <td>14"</td> <td>10"</td> </tr> <tr> <td>S 78°E</td> <td>S 08°E</td> <td>N 71°W</td> </tr> <tr> <td>11.9 Ft.</td> <td>9.2 Ft.</td> <td>30.9 Ft.</td> </tr> </table>				W. Oak	W. Oak	S. Oak	10"	14"	10"	S 78°E	S 08°E	N 71°W	11.9 Ft.	9.2 Ft.	30.9 Ft.
W. Oak	W. Oak	S. Oak															
10"	14"	10"															
S 78°E	S 08°E	N 71°W															
11.9 Ft.	9.2 Ft.	30.9 Ft.															
		Corner Recordation:		Certificate Prepared:													
		Filed and Recorded in County records:		Date:													
		Book:		Page:													
Section: 19		Geodetic Coordinates:		Lat./N.	Long./E.												
		Edited By: Robert J. Stone	Date Created:		11/30/04												



Index: N01

Corner: NW Cor
S19

LAND CORNER RECORD

State of Indiana
Hoosier National Forest

POLK. A13

Twnshp: 7N

Range: 1E


Section: 19 2nd P.M.

County: MONROE CO.


EXISTING SURVEYS

Original Government Survey				Original Survey Evidence Found			
Year Surveyed:	1814	By:	Author Henrie	Date of Search:		By:	
Original Monument:	Post			Monument Found:			
Species	Diameter	Bearing	Distance	Species	Diameter	Bearing	Distance
Hickory	6"	S10°E	2 Lks				
Dogwood	8"	S85°E	13 Lks				
Subsequent Corner Restoration				Evidence of Subsequent Corner Restoration Found			
Where Filed or Recorded:		Recorders Office		Year Searched:		By:	
Book: S. Bk 2		Page: 133		Monument Found			
Monument Set:		Not Indicated		Date: 1871			
Species	Diameter	Bearing	Distance	Species	Diameter	Bearing	Distance

OTHER EVIDENCE

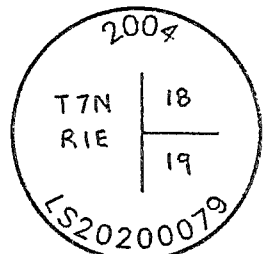Describe corner loc. relative to nearby features & dir. to corner location; note fences, roads, etc.	Sketch of Monument
The corner is on the southwest facing slope of a peninsula that extends to Monroe Lake at the northwest end of Hardin Ridge. The monuments is on a small ridge between 2 draws, approximately 250' east and 250' north of the lake. There is a large ravine about 100' east of the corner and the top of the ridge is about 200' northeast.	

PERPETUATION RECORD

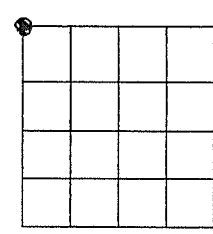Monument: Describe new monument set or work done to perpetuate/preserve the existing monument/position.							
Northwest corner of Section 19, Township 7 North, Range 1 East; A 2 1/2 inch aluminum monument with a 3 1/4 inch cap was set 1.3' above grade at the record distance noted Original Government Notes from a 5/8 inch iron pipe found at the Northeast corner of Section 25, T7N, R1W (N25), on a line to a metal post found at the South 1/16 corner on the east line of said Section 25. The record distance noted in said Original Government Notes was 427.68' (6.48 Chains). No proportionate measurement was used due to the lack of monuments available caused by the creation of Monroe Reservoir.							
Corner Diagram		Accessories: Describe new BTs & witness objects established to perpetuate existing evidence.					
		8" Pin Oak N75°W 30.9' 9" White Oak S85°E 11.9' 13" White Oak S10°E 9.2'					
		Corner Recordation:		Certificate Prepared:			
		Filed and Recorded in County records:		Date:			
		Book:		Page:			
Section: 19		Geodetic Coordinates:		Lat./N.		Long./E.	
		Edited By:		BTR		Date Created:	10/2004